## **TRC-6512 Tuning Procedure**

- 1. Power down the Changer
- 2. Do NOT unplug the Acceptor at anytime during the Tuning Process.
- 3. Set switches to the following: Switch 1 & 3 OFF Switch 2 ON
- 4. Open Acceptor and short out the 2 pins (lower left of control board)-Under Rubber
- 5. While the pins are shorted power up the changer--un-short the pins--close acceptor.
- 6. Drop in US Coins: Drop in 2 Nickels

Drop in 2 Dimes
Drop in 2 Quarters


Drop in 2 US Golden Dollars

Press return lever 2 times (this blocks out tokens)

7. The quarter and nickel tubes should have the lower sensors covered.

## NEVER HOT PLUG---EQUIPMENT DAMAGE COULD OCCUR



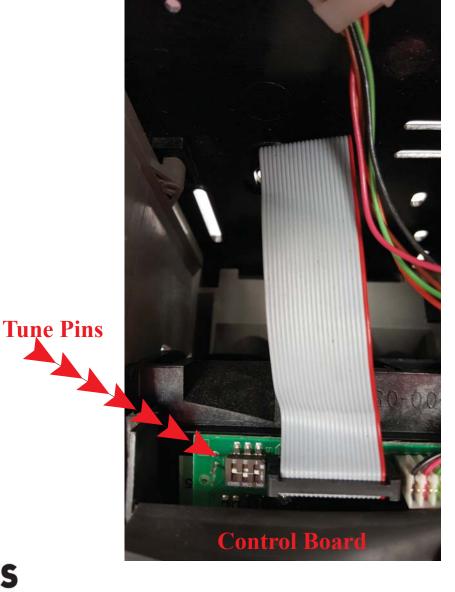



888.396.8363 - Atlanta 800.248.1712 - Orlando

www.vendorsrepair.com